


TMBE TABLE OF CONTENTS

* General View.....	P-1
* Main Gear Box.....	P-2
* End Box.....	P-3
* Hook Base.....	P-4
* Color Change System...	P-5
* Needle Bar Driver Syste	P-6
* Y-Axis Driver System...	P-7
* X-Axis Driver System...	P-8
* Tension Base.....	P-9



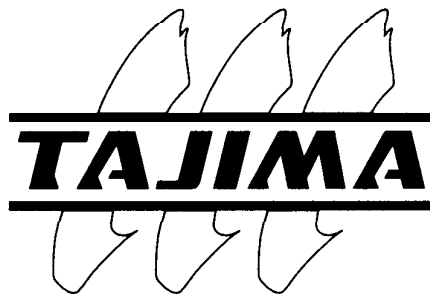

TMBE-600 GENERAL VIEW

P-1

No.	Name		No.	Name	
P1-1	Table stand		P1-31	Screw M 6×12	
-2	Nut M20		-32	Nut M 8	
-3	Set screw M 6×8		-33	No.2 Table support stud	TMBE-68-033
-4	Spring washer M10		-34	No.5 Table support	
-5	Washer M10		-35	Embroidery frame	TMBE-68-40~46
-6	Washer M 5		-36	Arm suspender pype	TMBE-68-161
-7	Nut M 5		-37	Rotary hook shaft, R	TMBE-68-070
-8	Screw M 4×12		-38	Rotary hook shaft, L	TMBE-68-071
-9	Bolt M 8×30		-39	Slide shaft, R	TMBE-68-173
-10	Spring washer M 8		-40	Side shaft, L	TMBE-68-179
-11	Washer M 8		-41	Needle-bar drive shaft, R	TMBE-68-074
-12	Bolt M 5×10		-42	Needle-bar drive shaft, L	TMBE-68-075
-13	Bolt M 4×10		-43	Take-up lever drive shaft, R	TMBE-68-176
-14	Washer M 4		-44	Take-up lever drive shaft, L	TMBE-68-177
-15	Table		-45	15φ Joint	TMBE-68-079
-16	Plate	TMBE-68-022	-46	Screw M 6×6	
-17	Tap screw 5φ		-47	Taper pin 4φX25	
-18	Y-axis guide plate	TMBE-68-023	-48	M 6 Joint	TMBE-68-180
-19	X-axis guide plate	TMBE-68-024	-49	Joint	TMBE-68-078
-20	Screw 3φX 5		-50	Beit cover	TMBE-68-081
-21	No.1 Table support		-51	Leveling bolt	TMBE-68-082
-22	No.2 Table support		-52	Leveling plate	TMBE-68-083
-23	No.3 Table support		-53	TA,IMA brand plate	TMBE-68-088
-24	No.4 Table support		-54	Seral No. plate	
-25	Screw 5φX15		-55	Fixing pin 2.2φX 5	
-26	No.3 Table support bracket	TMBE-68-031	-56	Tersion base bracket	TMBE-69-101
-27	Bolt M 6×15		-57	Bolt M 6×20	
-28	Spring washer M 6		-58	Screw M 4×10	
-29	Washer M 6		-59	Thread stand shaft	TMBE-69-002
-30	No.1 Table support bracket	TMBE-68-032	-60	Thread stand	TMBE-69-003

From the library of: Diamond Needle Corp


TMBE-600 GENERAL VIEW

P-1

No.	Name		No.	Name	
P1-61	Thread stud	TMBE-69-004	P1-91	Encoder drive bearing	TMEE-61-170
-62	Thread guide collar	TMBE-69-005	-92	Bolt M 5 X 6	
-63	Thread guide stay	TMBE-69-006	-93	Bolt M 6 X 12	
-64	Screw M 5 X 8		-94	Taper pin 4 φX25	
-65	No.1 Thread guide	TMBE-69-107	-95	Encoder bracket	TMEE-61-171
-66	Plastic thread guide	TMBE-69-060	-96	Bolt M 3 X 6	
-67	No.2 Thread guide	TMBE-69-108	-97	Encoder connecting shaft	TMBE-61-172
-68	No.1 Tension stud	TMBE-69-053	-98	Encoder drive pulley	TMBE-61-173
-69	No.1 Tension disk	TMBE-69-057	-99	Screw M 5 X 5	
-70	No.1 Tension spring	TMBE-69-059	-100	12φ Collar	TMBE-61-174
-71	No.1 Tension regulating nut	TMBE-69-058	-101	Encoder cover	TMBE-61-176
-72	Nut 11/64X40		-102	Encoder joint pulley	TMBE-61-175
-73	Washer 4.5φ		-103	Encoder drive belt	
-74	Motor pulley	TMEE-61-018	-104	Helical joint	
-75	Drive belt	TMEE-61-019	-105	Bolt M2.3X8	
-76	Angle pointer stud	TMEE-68-038	-106	Encoder	
-77	Angle pointer	TMEE-68-039	-107	Electric box	
-78	Cable clip		-108	Control box	
-79	Cable clip		-109	Motor	
-80	Drive unit		-110	Screw M 4 X 6	
-81	Bolt M10X35				
-82					
-83	Nut M 6				
-84	Nut M 6				
-85	Bolt M 6 X 25				
-86	Bar switch				
-87	Bar switch box				
-88	Bar switch supporter				
-89	Screw M 5 X 8				
-90	Thread guide	TMBE-69-056			


From the library of: Diamond Needle Corp

—TMBE-600 MAIN GEAR BOX—

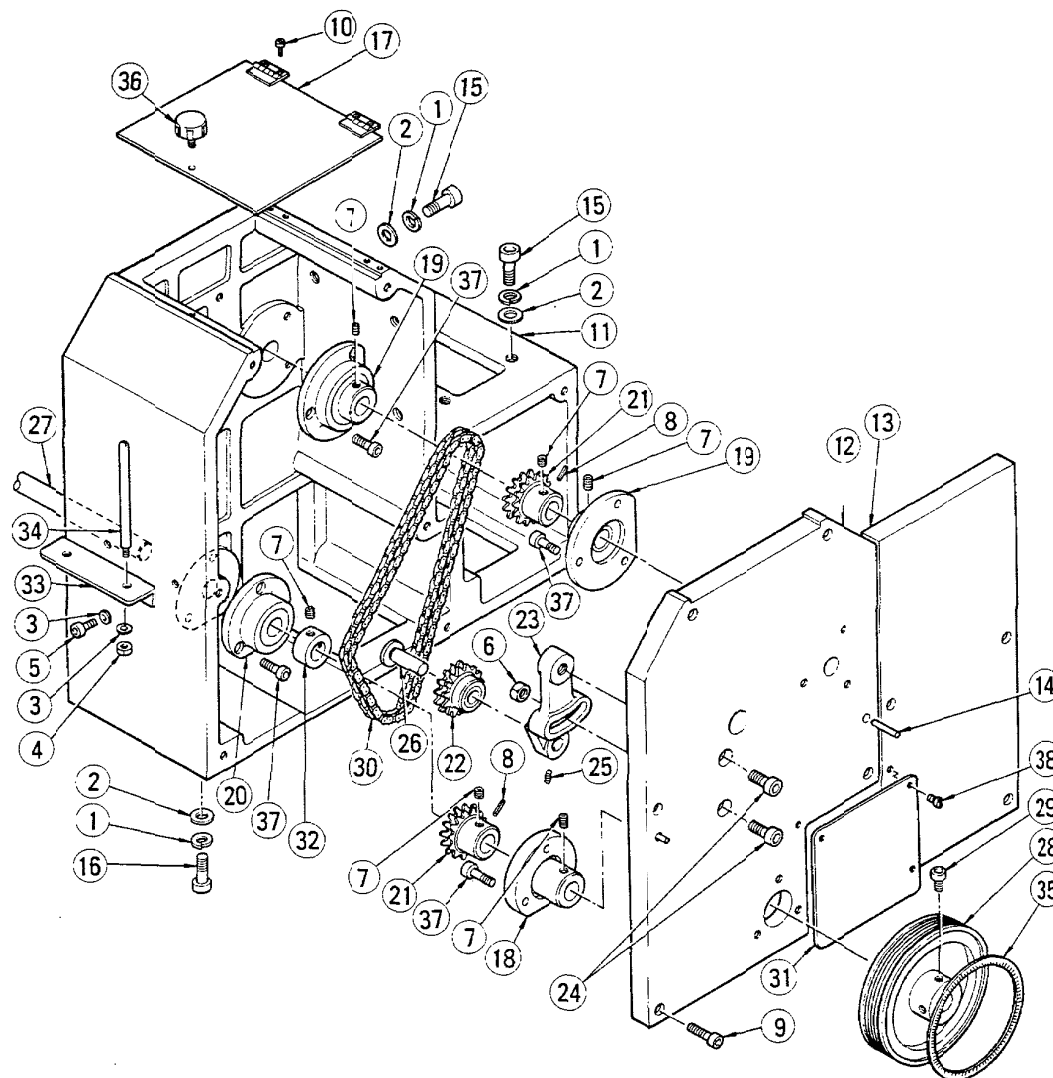

From the library of: Diamond Needle Corp

TMBE-600 MAIN GEAR

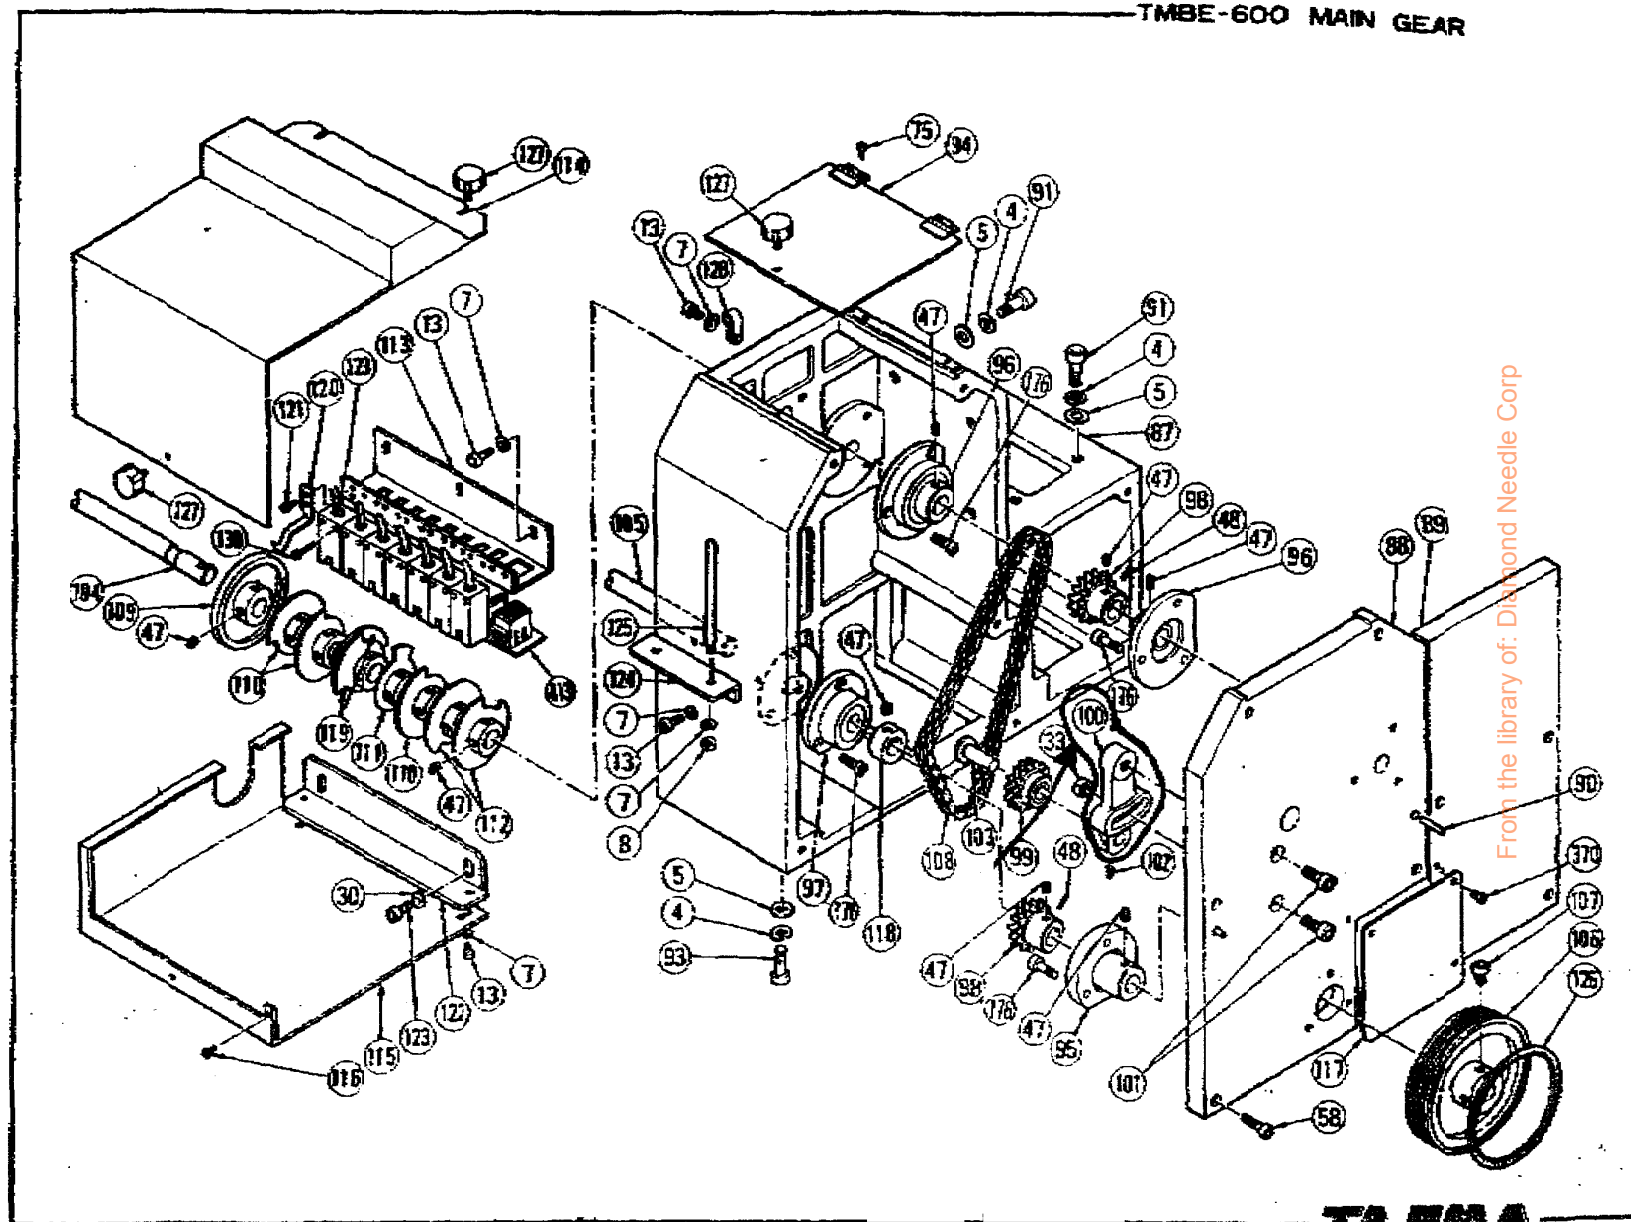

From the library of: Diamond Needle Corp


TAMBA

TMBE-600 MAIN GEAR BOX

P-2

No.	Name		No.	Name	
P2-1	Spring washer M10		P2-31	Cover	TMBE-61-028
-2	Washer M10		-32	15 ϕ Collar	TMBE-61-041
-3	Washer M5		-33	Bobbin thread base	TMBE-61-061
-4	Nut M5		-34	Bobbin thread stud	TMBE-61-062
-5	Bolt M8 $\times$ 10		-35	Angle Indicator ring	TMEE-61-066
-6	Nut M8		-36	Screw	EF-1-3
-7	Screw M6 $\times$ 6		-37	Bolt M5 $\times$ 15	
-8	Taper pin 4 ϕ $\times$ 24		-38	Screw M4 $\times$ 5	
-9	Bolt M6 $\times$ 20				
-10	Screw M3 $\times$ 5				
-11	Main gear box	TMEE-61-101			
-12	Main gear box cover 1	TMEE-61-102			
-13	Main gear box cover 2	TMEE-61-102			
-14	Strait pin 4 ϕ $\times$ 20				
-15	Bolt M10 $\times$ 35				
-16	Bolt M10 $\times$ 40				
-17	Main gear box top cover	TMEE-61-105			
-18	No.1 Bearing	TMEE-61-007			
-19	No.2 Bearing	TMEE-61-008			
-20	No.3 Bearing	TMEE-61-009			
-21	15 ϕ Sprocket	TMBE-61-010			
-22	10 ϕ Sprocket	TMBE-61-011			
-23	Tension bracket	TMBE-61-012			
-24	Bolt M8 $\times$ 20				
-25	Screw M5 $\times$ 8				
-26	Tension pin	TMBE-61-013			
-27	Lower main shaft	TMBE-61-015			
-28	Shaft pulley	TMBE-61-017			
-29	Bolt M6 $\times$ 12				
-30	W Chain				

From the library of: Diamond Needle Corp

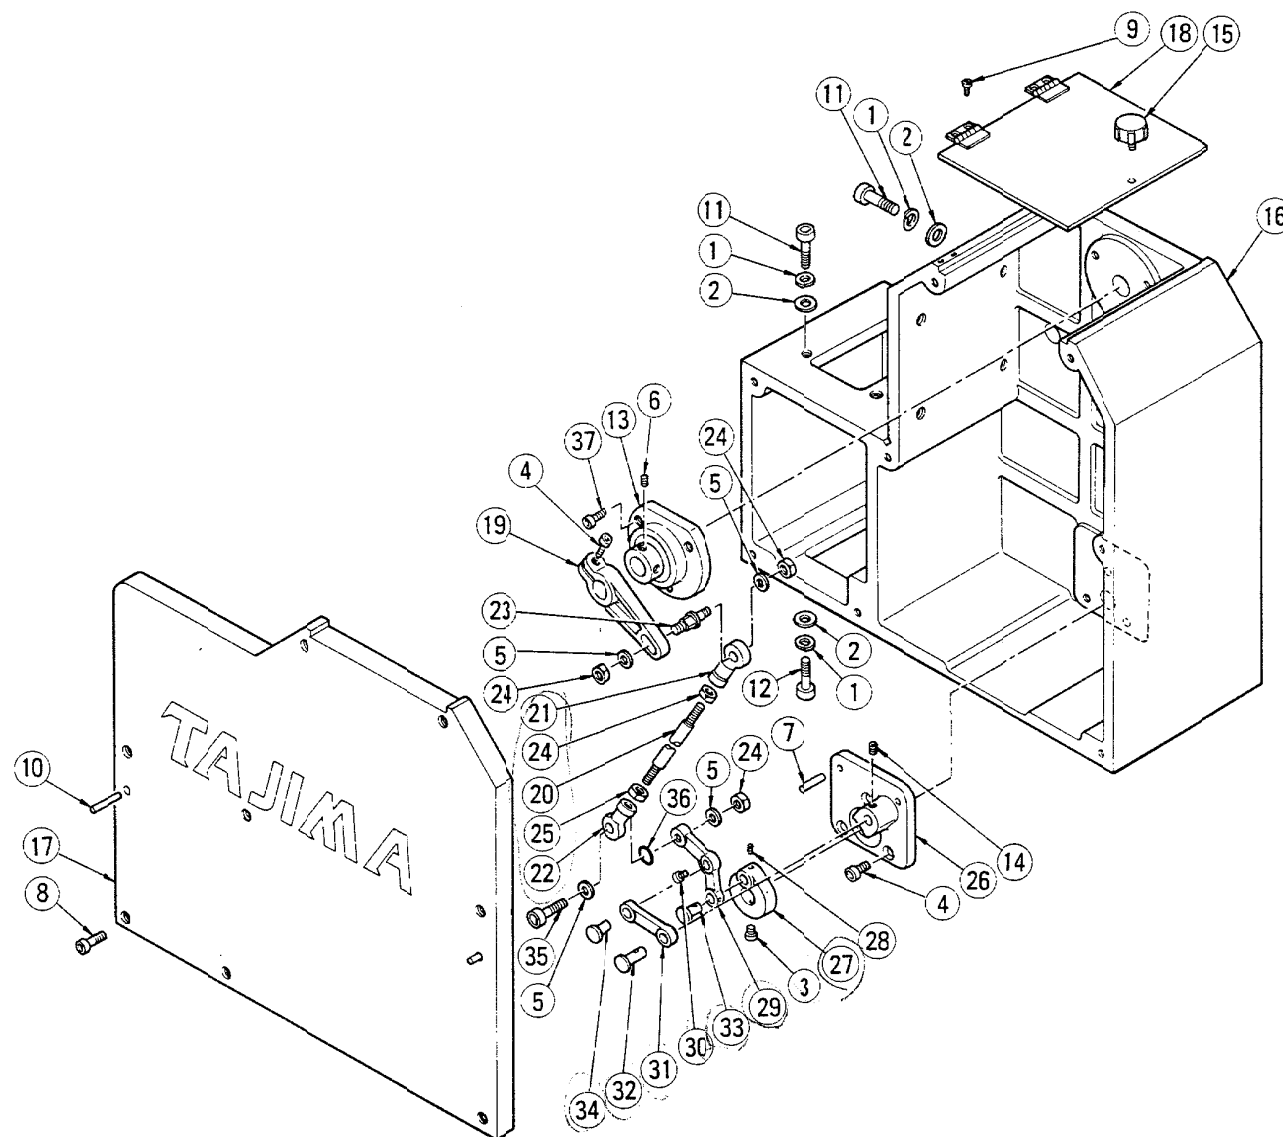

From the library of: Diamond Needle Corp

TMBE-600


END BOX

P-3

No.	Name		No.	Name	
P3-1	Spring washer M10		P3-31	No.2 Take-up lever arm	
-2	Washer M10		-32	No.1 Pin	
-3	Bolt M5×10		-33	No.2 Pin	
-4	Bolt M6×15		-34	No.3 Pin	
-5	Washer M6		-35	Bolt M6×25	
-6	Screw M6×6		-36	O-ring	
-7	Taper pin 4φ×25		-37	Bolt M5×15	
-8	Bolt M6×20				
-9	Screw M3×5				
-10	Strait pin 4φ×20				
-11	Bolt M10×35				
-12	Bolt M10×40				
-13	No.2 Bearing	TMBE-61-008			
-14	Screw M5×8				
-15	Screw	EF-1-3			
-16	End box	TMBE-61-103			
-17	Enc box cover	TMBE-61-104			
-18	End box top cover	TMBE-61-106			
-19	No.1 Take-up lever drive arm	TMBE-61-130			
-20	Connecting rod	TMBE-61-132			
-21	Roc end bearing R				
-22	Roc end bearing L				
-23	Roc end bearing pin				
-24	Nut M6				
-25	Nut M6				
-26	Take-up lever base				
-27	Take-up lever cam				
-28	Set screw M5×5				
-29	No.1 Take-up lever arm				
-30	Screw 9/64×40×8				

From the library of: Diamond Needle Corp

TMBE-600 HOOK BASE

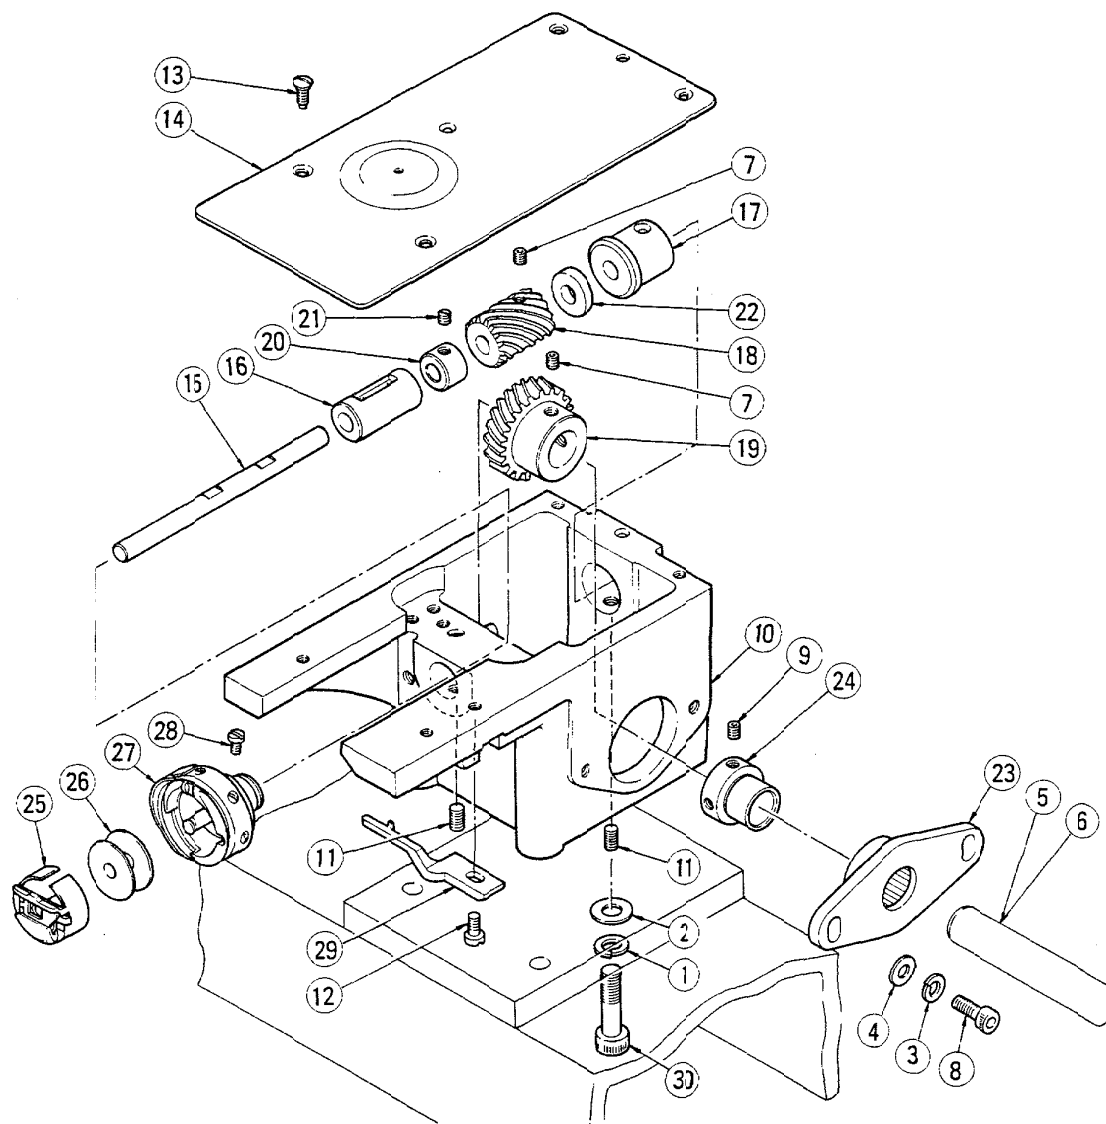


From the library of: Diamond Needle Corp

TMBE-600 HOOK BASE

P-4

No.	Name		No.	Name		
P4-1	Spring washer M 8					
-2	Washer M 8					
-3	Spring washer M 6					
-4	Washer M 6					
-5	Rotary hook shaft, R	TMEE-68-070				
-6	Rotary hook shaft, L	TMEE-68-071				
-7	Screw M 6 X 6					
-8	Bolt M 6 X 20					
-9	Set screw M 5 X 5					
-10	Rotary hook base	TMEE-62-001				
-11	Set screw M 6 X 10					
-12	Screw 11/64 X 40 X 15					
-13	Screw 11/64 X 40					
-14	Needle plate	TMEE-62-003				
-15	Rotary hook shaft	TMEE-62-004				
-16	Shaft bushing A	TMEE-62-005				
-17	Shaft bushing B	TMEE-62-006				
-18	Spiral gear B	TMEE-62-007				
-19	Spiral gear A	TMEE-62-008				
-20	Shaft collar	TMEE-62-009				
-21	Set screw 1/4 X 40 X 5					
-22	Shaft spacer	TMEE-62-010				
-23	Rotary hook shaft bearing	TMEE-62-011				
-24	Needle collar	TMEE-62-011-2				
-25	Bobbin case					
-26	Bobbin					
-27	Rotary hook					
-28	Rotary hook fixing screw					
-29	Rotary hook support					
-30	Bolt M 8 X 35					

From the library of: Diamond Needle Corp

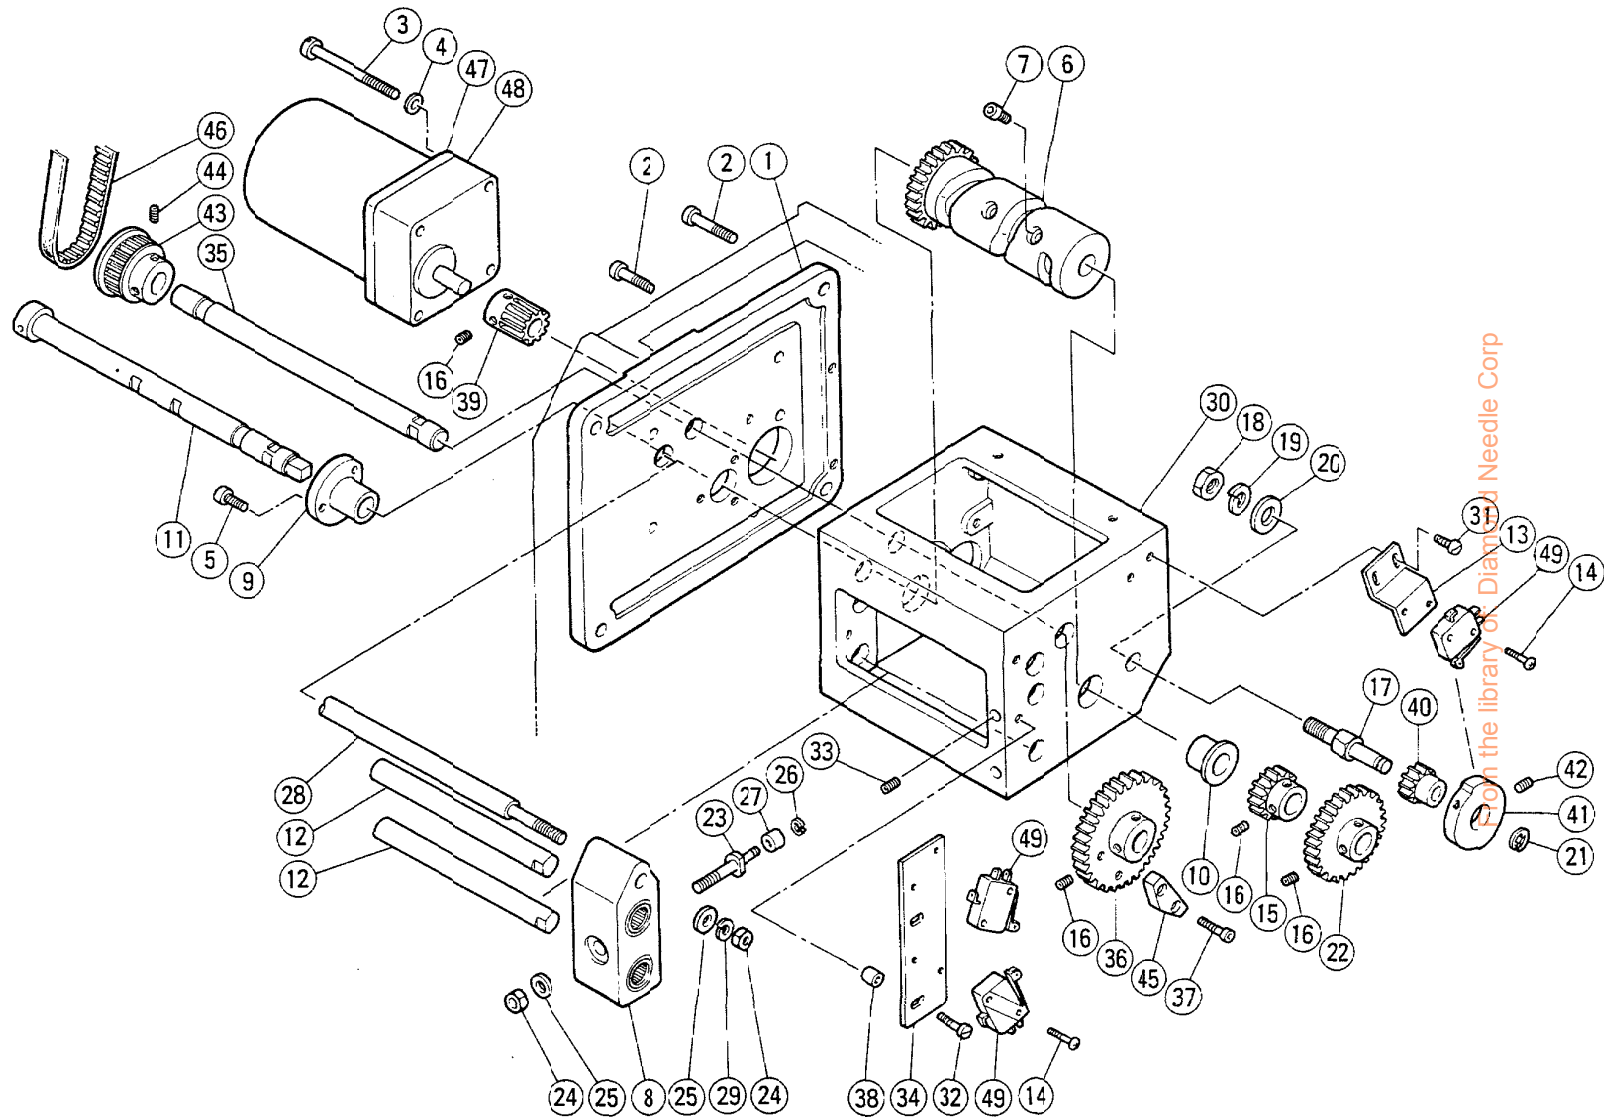


TMBE-600 COLOR CHANGE SYSTEM

P-5

No.	Name		No.	Name	
P5-1	Color change motor base	TMBE-64-101-2	P5-31	Screw M 4 × 6	
-2	Bolt M 5 × 18		-32	Screw M 4 × 12	
-3	Screw M 5 × 50		-33	Set screw M 4 × 8	
-4	Washer M 5		-34	Terminal switch base	TMBE-64-141
-5	Bolt M 4 × 10		-35	Tension release shaft	TMBE-64-142
-6	Color change cam	TMBE-64-103-2	-36	Terminal gear	TMBE-64-143
-7	Bolt M 6 × 8		-37	Bolt M 3 × 10	
-8	Slide boss	TMBE-64-104-2	-38	Terminal micro switch spacer	TMBE-64-144
-9	No.1 Cam bushing	TMBE-64-107-2	-39	Motor gear	TME-6412
-10	No.2 Cam bushing	TMBE-64-108-2	-40	One turn gear	TME-6422
-11	Cam shaft	TMBE-64-111-2	-41	Switch collar	TME-6425
-12	Guide shaft	TMBE-64-112-2	-42	Set screw M 4 × 5	
-13	Half turn switch base	TMBE-64-118-2	-43	Thread releasing driving pulley	TME-6429
-14	Screw M 3 × 12		-44	Set screw	
-15	Terminal driving gear	TMBE-64-119-2	-45	Terminal detecting contact point	TME-6447
-16	Set screw M 5 × 5		-46	Timing belt	T5-10-105
-17	Half-turn driving gear	TMBE-64-121-2	-47	Motor	
-18	Nut M 8		-48	Gear box	
-19	Spring washer M 8		-49	limit switch	
-20	Washer M 8				
-21	E ring				
-22	Half turn driving gear	TMBE-64-130			
-23	Cam pin	TMBE-64-105			
-24	Nut M 6				
-25	Washer				
-26	E ring				
-27	Cam collar	TMBE-64-106			
-28	Slide shaft	TMBE-64-113			
-29	Spring washer				
-30	Color change box	TMBE-64-140			

From the library of: Diamond Needle Corp

TMBE-6/ NEEDLE BAR DRIVER SYSTEM

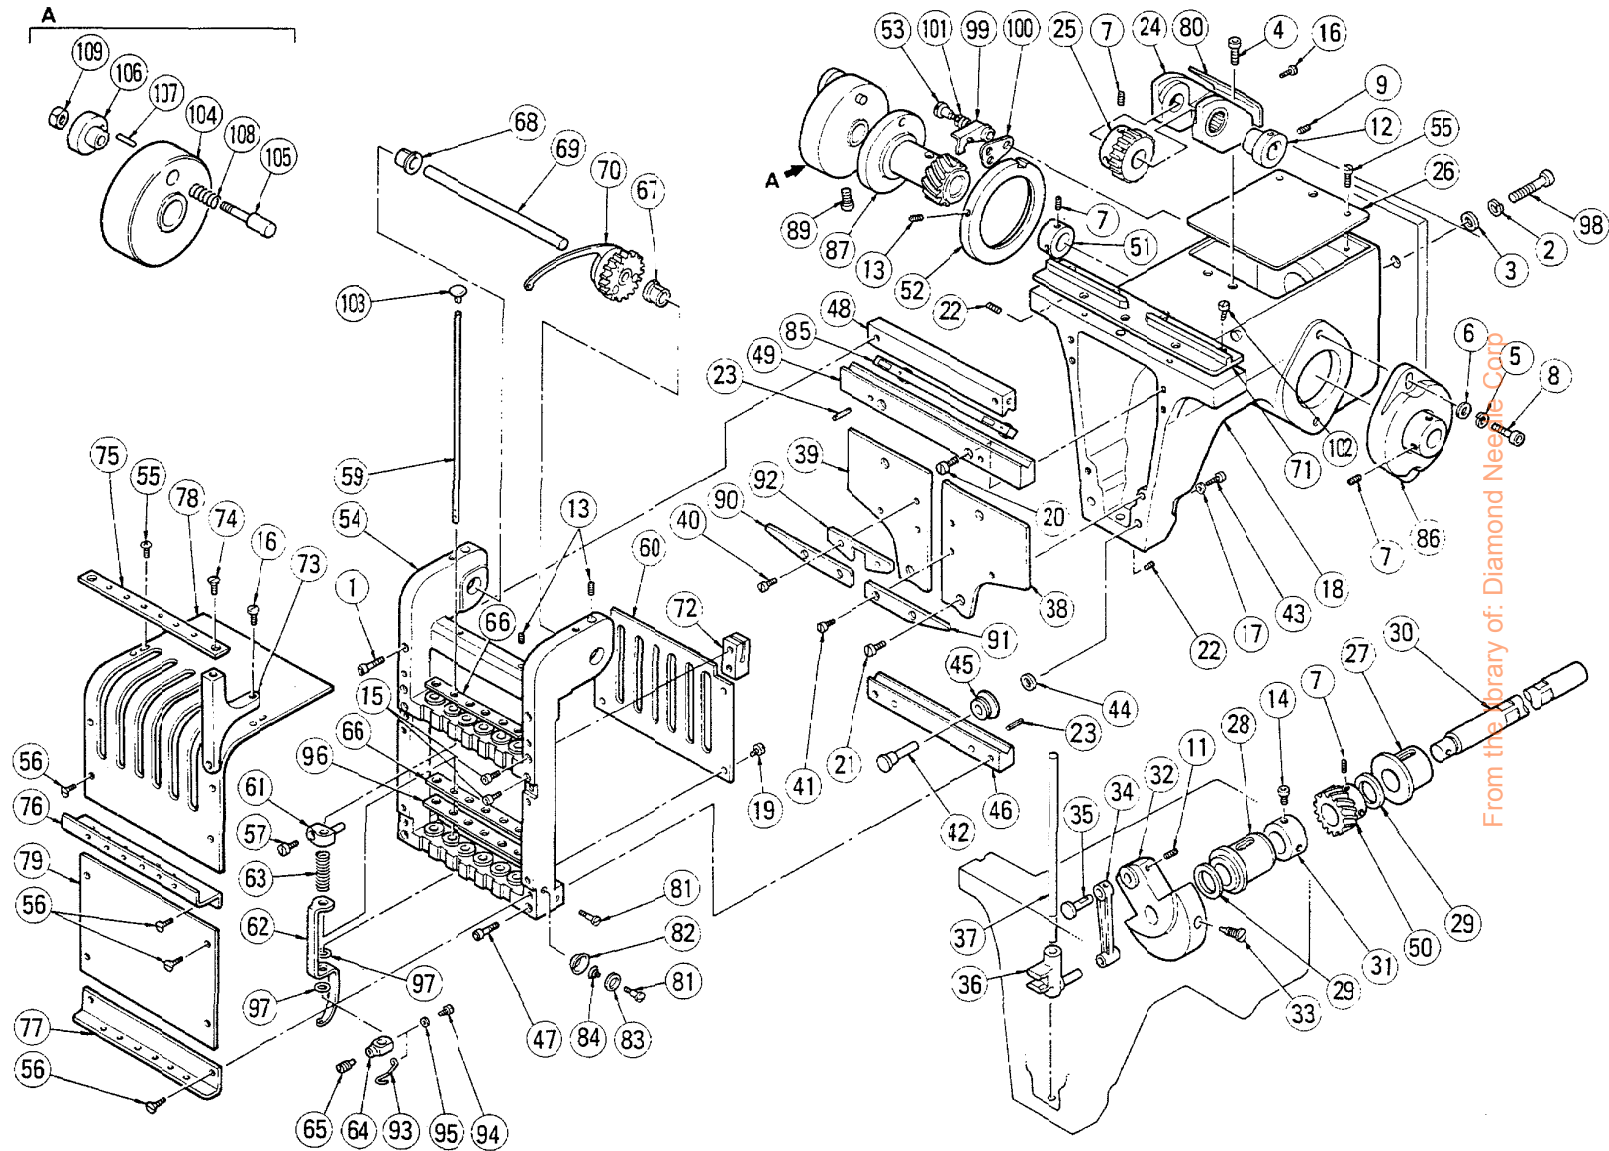

From the library of: Diamond Needle Corp

TMBE-600 NEEDLE BAR DRIVER SYSTEM

P-6

No.	Name		No.	Name	
P6-1	Bot M 5×25		P6-31	Arm shaft collar	TMBE-66-012
-2	Spring washer M 8		-32	Arm shaft cam	TMBE-66-013
-3	Washer M 8		-33	Cam set screw 9/32×28	
-4	Bot M 6×15		-34	Connecting rod	TMBE-66-114
-5	Spring washer M 6		-35	Arm shaft cam pin	TMBE-66-115
-6	Washer M 6		-36	Needle bar drive	TMBE-66-116
-7	Screw M 6×5		-37	Driving shaft	TMBE-66-117
-8	Bot M 6×20		-38	Guide plate R	TMBE-66-118-R
-9	Set screw M 5×5		-39	Guide plate L	TMBE-66-118-L
-10			-40	Screw 9/64×40×5	
-11	Set screw 1/4×40×5		-41	Screw 9/64×40×4	
-12	Needle collar	TMBE-62-011-2	-42	Roller pin	TMBE-66-120
-13	Set screw M 5×6		-43	Screw M 3×18	
-14	Bot M 6×8		-44	Liner plate	TMBE-66-121
-15	Bot M 4×22		-45	No. 1 Roller	TMBE-66-122
-16	Screw M 3×5		-46	Guide rail (Lower)	TMBE-66-123
-17	Washer M 3		-47	Bolt M 5×22	
-18	Arm	TMBE-66-101	-48	Guide rail (Upper)	TMBE-66-124
-19	Screw 9/64×40×10		-49	Guide rail	TMBE-66-128
-20	Screw 11/64×40×12		-50	Arm shaft gear	TMBE-66-031
-21	Screw 11/64×40×10		-51	Gear collar	TMBE-66-032
-22	Set screw 15/64×28×10		-52	Clutch ring	TMBE-66-036
-23	Spring pin 3/8×15		-53	Lever pin	TMBE-66-042
-24	Take-up lever drive shaft bearing	TMBE-66-103	-54	Head	TMBE-66-145
-25	Take-up lever gear	TMBE-66-105	-55	Screw 9/64×40×3	
-26	Arm cover	TMBE-66-007	-56	Screw 9/64×40×6	
-27	Arm shaft rear bushing	TMBE-66-008	-57	Set screw 9/64×40×8	
-28	Arm shaft front bushing	TMBE-66-009	-58		
-29	Spacer	TMBE-66-010	-59	Needle bar	TMBE-66-148
-30	Arm shaft	TMBE-66-011	-60	Needle bar guide rail	TMBE-66-149


From the library of: Diamond Needle Corp

TMBE-600 NEEDLE BAR DRIVE SYSTEM

P-6

No.	Name		No.	Name	
P6-61	Needle bar connecting stud	TMBE-66-150	P6-91	Needle bar stopper rail, R	TMEE-66-201F
-62	Pressure foot	TMBE-66-151	-92	Needle bar guide	TMEE-66-202
-63	Pressure foot spring	TMBE-66-152	-93	Thread guide	TMEE-66-204
-64	Needle clamp	TMBE-66-053	-94	Screw 3/32X56X3	
-65	Needle set screw	TMBE-66-054	-95	Washer M2.5	
-66	Felt packing	TMBE-66-155	-96	Felt packing	
-67	Take-up lever bushing	TMBE-66-159	-97	O ring	
-68	Take-up lever positioner bushing	TMBE-66-160	-98	Bolt M 8 X 35	
-69	Take-up lever shaft	TMBE-66-161	-99	Stopper lever	FE 64-073
-70	Take-up lever	TMBE-66-162	-100	Position setting plate	FE 64-079
-71	Take-up guide rail		-101	Stopper spring	FE 64-100
-72	Change bracket	TMBE-66-166	-102	Screw 9/64X40X5	
-73	Thread guide bracket	TMBE-66-167	-103	Needle bar cap	
-74	Screw M 3 X 6		-104	Clutch base B	TMEE-66-C34
-75	Upper thread guide	TMBE-66-168	-105	Guide pin	TMEE-66-C33
-76	Middle thread guide	TMBE-66-169	-106	Knot	TMEE-66-C37
-77	Lower thread guide	TMBE-66-170	-107	Set pin	TMEE-66-C40
-78	Top cover	TMBE-66-171	-108	Clutch spring	TMEE-66-039
-79	Face plate	TMBE-66-172	-109	Nut M 4	
-80	Bearing cover	TMBE-66-173			
-81	Thread suspender screw	TMBE-66-C73			
-82	Thread suspender disc	TMBE-66-074			
-83	Spring presser	TMBE-66-075			
-84	Thread suspender spring	TMBE-66-076			
-85	Slider	TMBE-66-180			
-86	Bearing	TMBE-66-C81			
-87	Clutch base A	TMBE-66-082			
-88					
-89	Bolt M 8 X 15				
-90	Needle bar stopper rail, L	TMEE-66-201L			

From the library of: Diamond Needle Corp

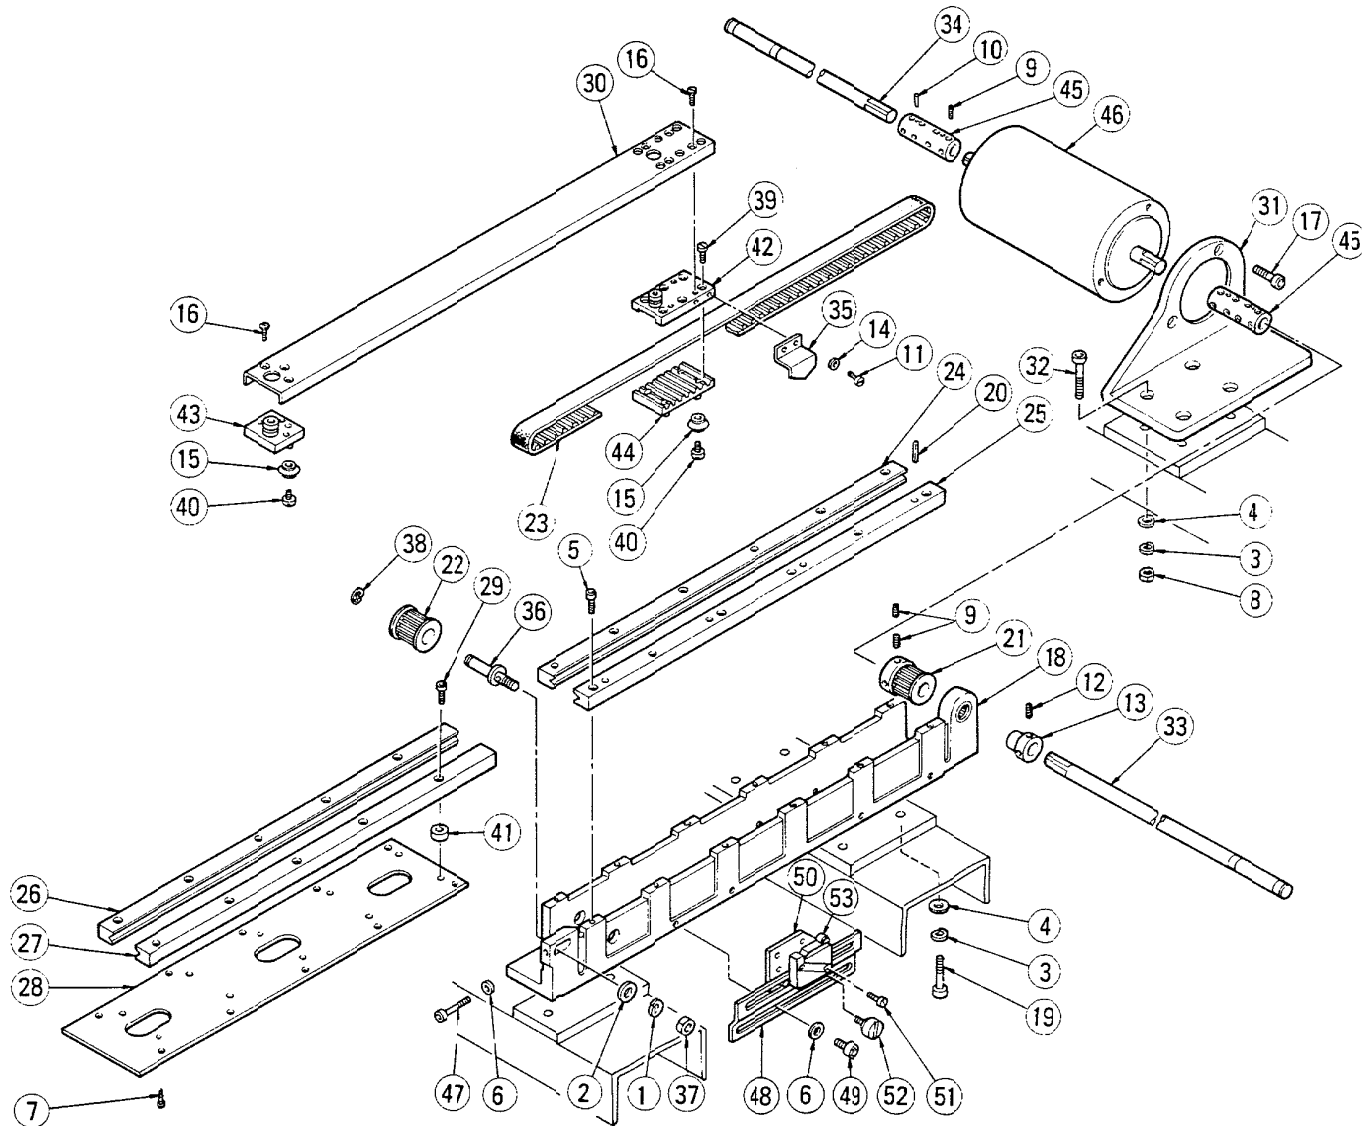

From the library of: Diamond Needle Corp

TMBE-600 Y-AXIS DRIVER SYSTEM

P-7

No.	Name		No.	Name	
P7-1	Spring washer M10		P7-25	No.2 Rail(Y-axis)	TMBE-67-019-450
-2	Washer M10		-25	No.2 Rail(Y-axis)	TMBE-67-019-680
-3	Spring washer M8		-25	No.2 Rail(Y-axis)	TMBE-67-019-750
-4	Washer M8		-26	No.3 Rail(Y-axis), L	TMBE-67-020-1-450
-5	Bolt M4×10		-26	No.3 Rail(Y-axis), L	TMBE-67-020-1-680
-6	Washer M4		-26	No.3 Rail(Y-axis), L	TMBE-67-020-1-750
-7	Screw 5φ×15		-27	No.3 Rail(Y-axis), R	TMBE-67-020-2-450
-8	Nut M8		-27	No.3 Rail(Y-axis), R	TMBE-67-020-2-680
-9	Screw M6×6		-27	No.3 Rail(Y-axis), R	TMBE-67-020-2-750
-10	Taper pin 4φ×25		-28	Rail holder	TMBE-67-024-450
-11	Screw M3×10		-28	Rail holder	TMBE-67-024-680
-12	Set screw M5×5		-28	Rail holder	TMBE-67-024-750
-13	Needle collar	TMBE-62-011-2	-29	Bolt M4×15	
-14	Washer M3		-30	Y-axis connecting plate	TMBE-67-030-450
-15	No.1 Roller	TMBE-66-122	-30	Y-axis connecting plate	TMBE-67-030-680
-16	Screw M4×8		-30	Y-axis connecting plate	TMBE-67-030-750
-17	Bolt M8×15		-31	Motor base(Y-axis)	TMBE-67-037
-18	Y-axis driver frame	TMBE-67-002-450	-32	Bolt M8×40	
-18	Y-axis driver frame	TMBE-67-002-680	-33	No.1 Y-axis drive shaft	
-18	Y-axis driver frame	TMBE-67-002-750	-34	No.2 Y-axis drive shaft	
-19	Bolt M8×35		-35	Y-axis safety stop bracket	TMBE-67-046
-20	Spring pin 4φ×10		-36	Pully pin	TMBE-67-050
-21	Timing pulley A	TMBE-67-005	-37	Nut M10	
-22	Timing pulley B	TMBE-67-006	-38	E ring	
-23	Y-axis drive belt	TMBE-67-007-450	-39	Screw M4×10	
-23	Y-axis drive belt	TMBE-67-007-680	-40	Roller set screw	TMBE-67-051
-23	Y-axis drive belt	TMBE-67-007-750	-41	Rail spacer	
-24	No.1 Rail(Y-axis)	TMBE-67-018-450	-42	Y-axis frame driver(Rear)	TMBE-67-060-450(680)
-24	No.1 Rail(Y-axis)	TMBE-67-018-680	-42	Y-axis frame driver(Rear)	TMBE-67-060-750
-24	No.1 Rail(Y-axis)	TMBE-67-018-750	-43	Y-axis frame driver(Front)	TMBE-67-061


From the library of: Diamond Needle Corp

TMBF-600 Y-AXIS DRIVER SYSTEM

P-7

[illegible]

From the library of: Diamond Needle Corp

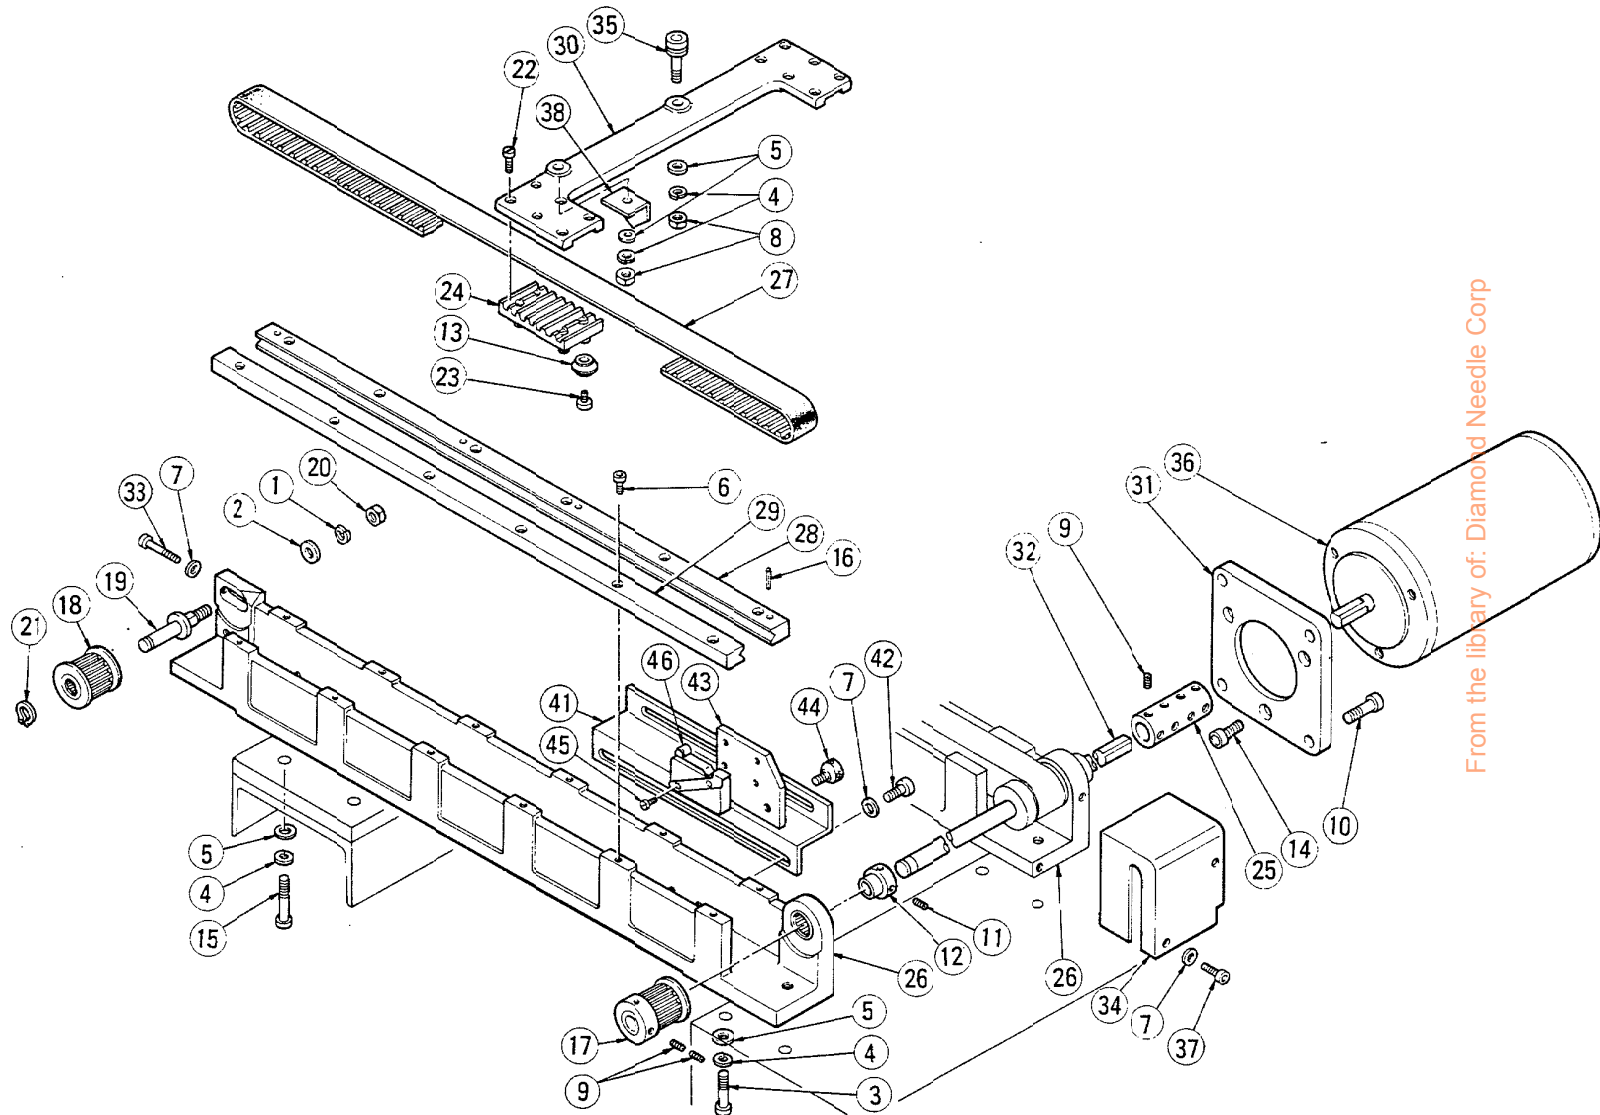

From the library of: Diamond Needle Corp

TMBF-600 X-AXIS DRIVER SYSTEM

P-8

No.	Name			No.	Name		
P8-1	Spring washer M10			P8-26	X-axis driver frame	TM3E-67-004	460 (230W)
-2	Washer M10			-27	X-axis drive belt	TM3E-67-008	275
-3	Bolt M 8×30			-27	X-axis drive belt	TM3E-67-008	295
-4	Spring washer M 8			-27	X-axis drive belt	TM3E-67-008	345
-5	Washer M 8			-27	X-axis drive belt	TM3E-67-008	360
-6	Bolt M 4×10			-27	X-axis drive belt	TM3E-67-008	400
-7	Washer M 4			-27	X-axis drive belt	TM3E-67-008	460 (230W)
-8	Nut M 8			-28	No.1 Rail(X-axis)	TMBE-67-021	275
-9	Screw M 6×6			-28	No.1 Rail(X-axis)	TMBE-67-021	295
-10	Bolt M 8×20			-28	No.1 Rail(X-axis)	TMBE-67-021	345
-11	Set screw M 5×5			-28	No.1 Rail(X-axis)	TMBE-67-021	360
-12	Needle collar	TMBE-62-011-2		-28	No.1 Rail(X-axis)	TMBE-67-021	400
-13	No.1 Roller	TMBE-66-122		-28	No.1 Rail(X-axis)	TMBE-67-021	460 (230W)
-14	Bolt M 8×15			-29	No.2 Rail(X-axis)	TMBE-67-022	275
-15	Bolt M 8×35			-29	No.2 Rail(X-axis)	TMBE-67-022	295
-16	Spring pin 4φ×10			-29	No.2 Rail(X-axis)	TMBE-67-022	345
-17	Timing pulley A	TM3E-67-005		-29	No.2 Rail(X-axis)	TMBE-67-022	360
-18	Timing pulley B	TM3E-67-006		-29	No.2 Rail(X-axis)	TMBE-67-022	400
-19	Pulley pin	TM3E-67-050		-29	No.2 Rail(X-axis)	TMBE-67-022	460 (230W)
-20	Nut M10			-30	X-axis frame driver	TMBE-67-027	
-21	E ring			-31	Motor Base(X-axis)	TMBE-67-038	
-22	Screw M 4×10			-32	X-axis drive shaft	TMBE-67-044	
-23	Roller set screw	TM3E-67-051		-33	Bolt M 4×25		
-24	Belt catcher plate	TM3E-67-062		-34	Driver cover	TMBE-67-048	
-25	15φ Joint	TM3E-67-079		-35	No.3 Frame driver pin	TMBE-67-049	
-26	X-axis driver frame	TM3E-67-004	275	-36	X-axis pulse motor		
-26	X-axis driver frame	TM3E-67-004	295	-37	Screw M 4×6		
-26	X-axis driver frame	TM3E-67-004	345	-38	Safety stopping plate for horizontal driving	TME-6714	
-26	X-axis driver frame	TM3E-67-004	360	-39			
-26	X-axis driver frame	TM3E-67-004	400	-40			


TMBF-600 X-AXIS DRIVER SYSTEM

P-8

[illegible]

From the library of: Diamond Needle Corp

TMBE-600 TENSION BASE

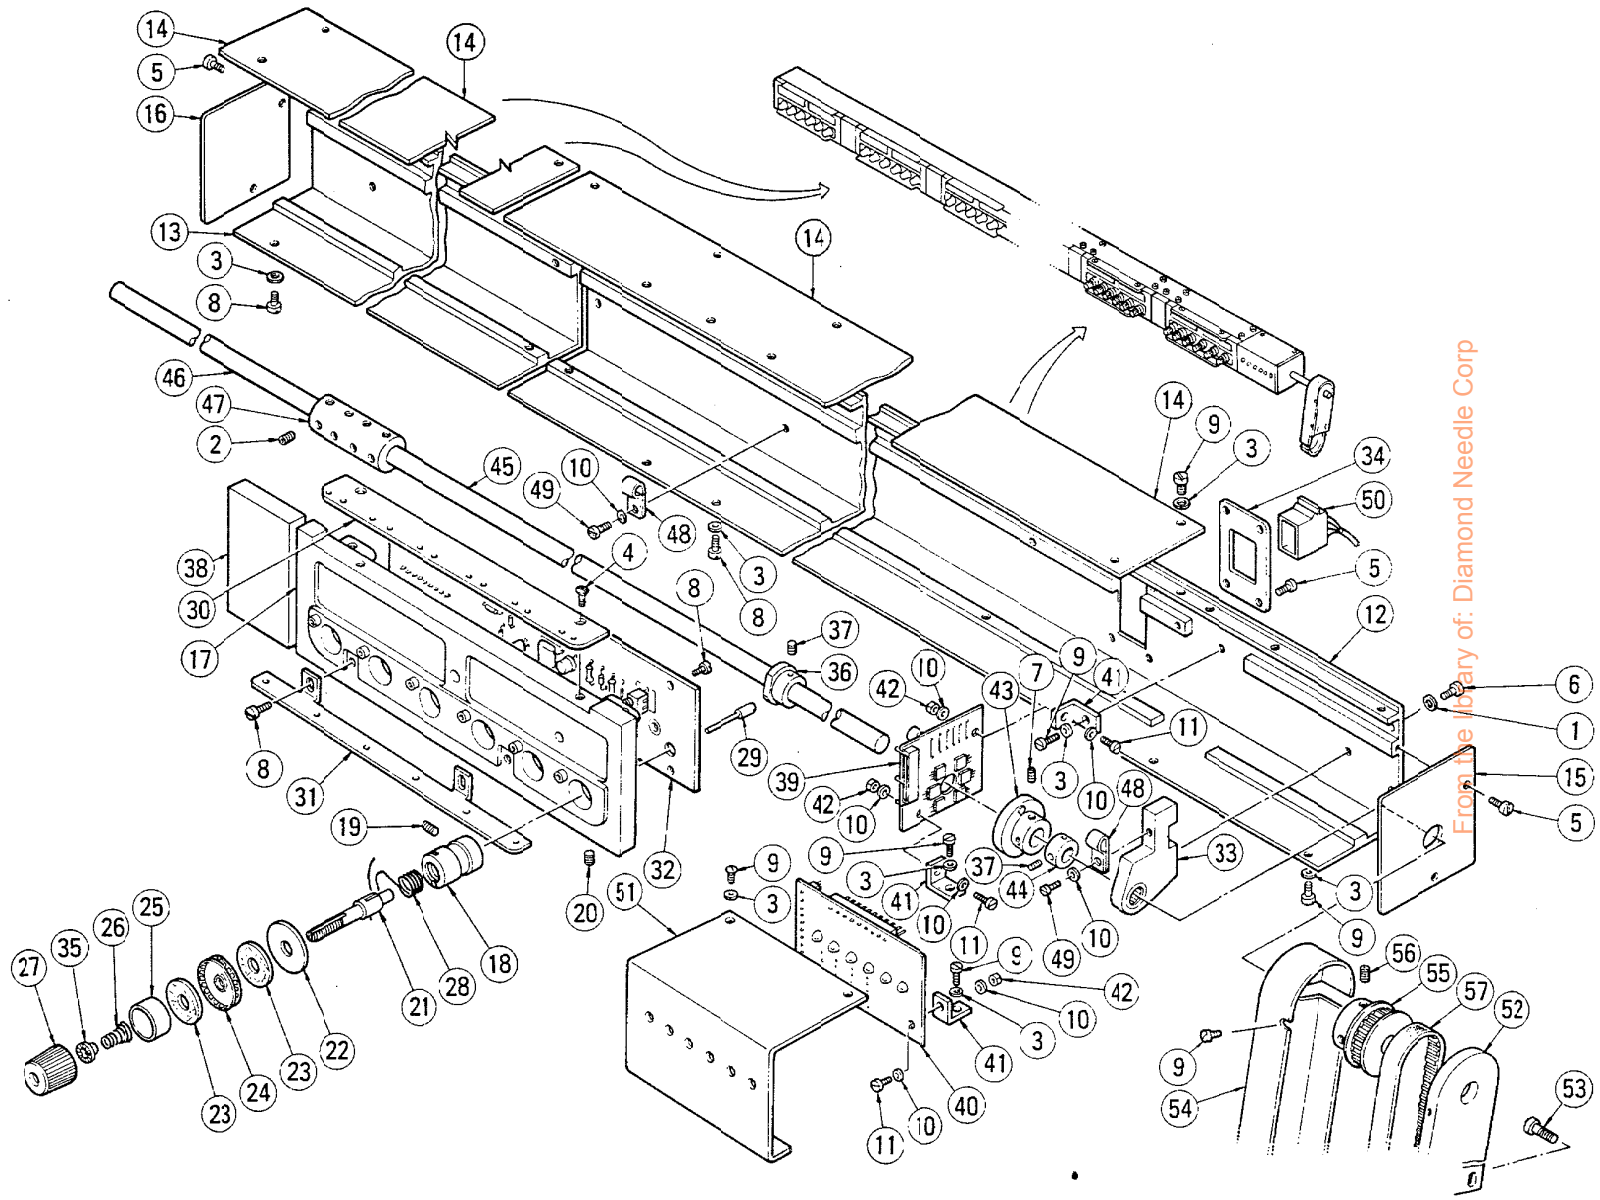


From the library of: Diamond Needle Corp

P-S

TAJIMA

TMBE-600. TENSION BASE & TENSION RELEASE

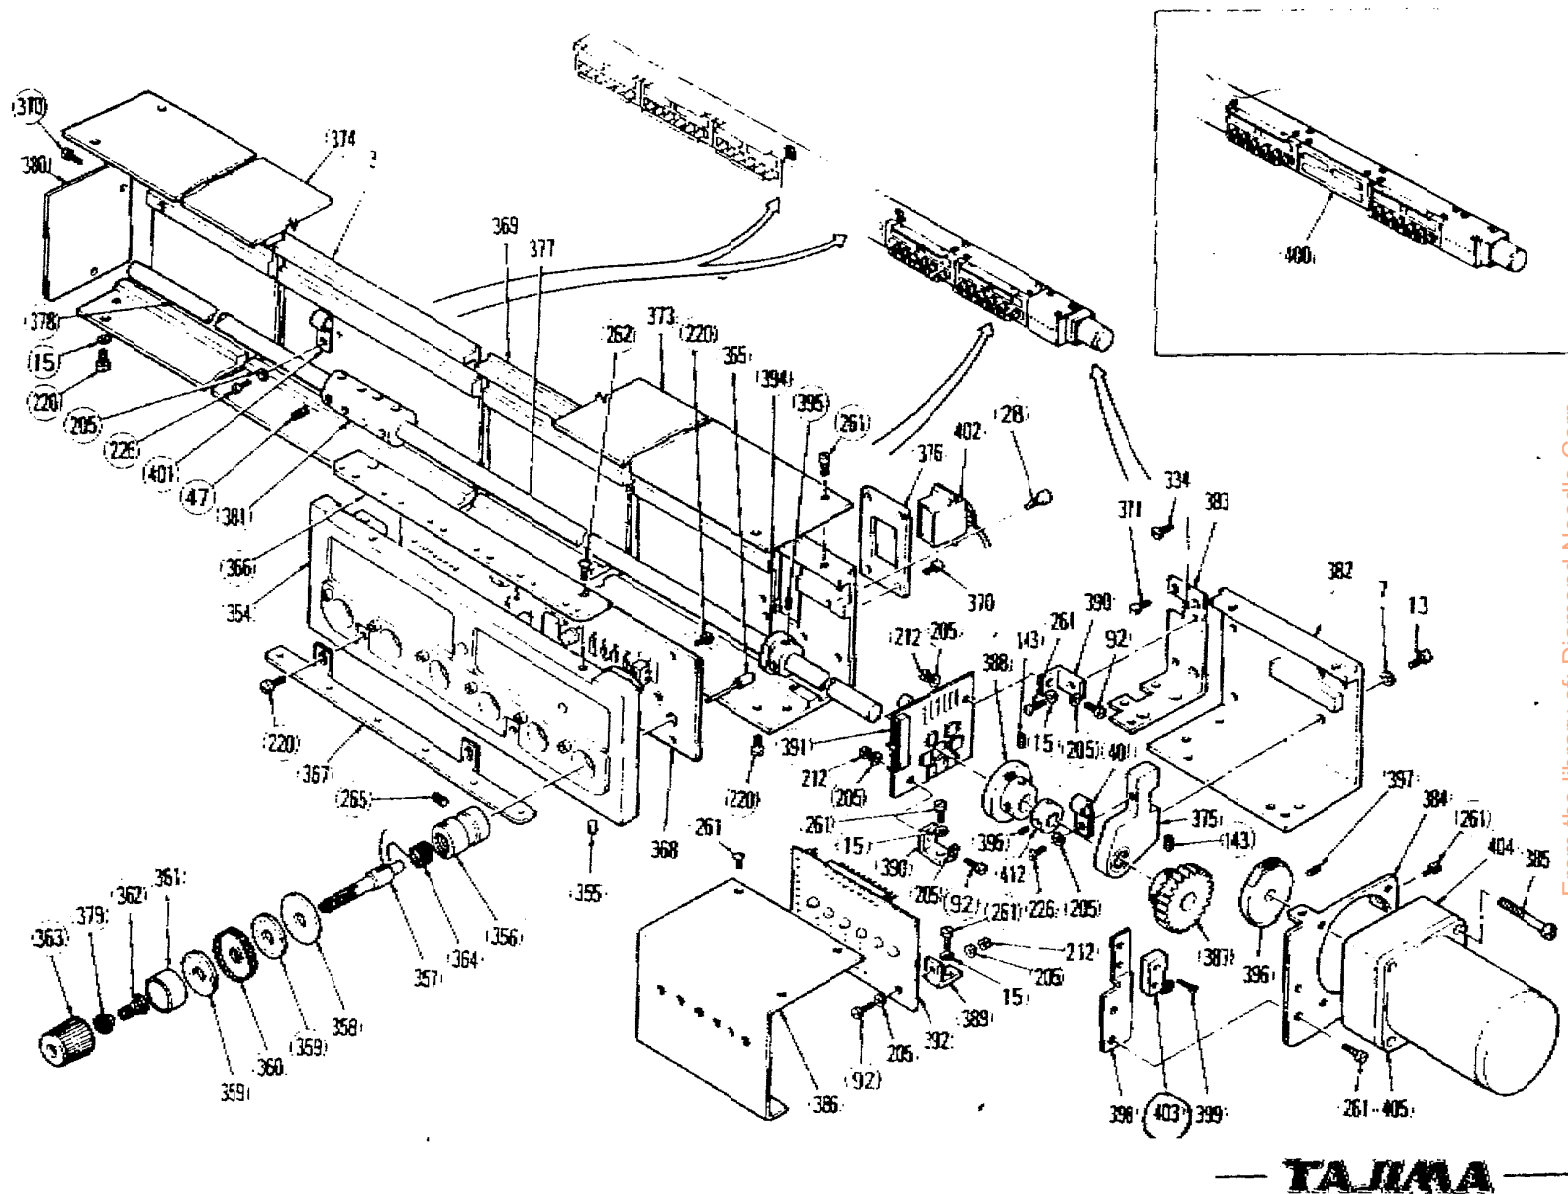

From the library of: Diamond Needle Corp

TMBE-600 TENSION BASE & TENSION RELEASE SYSTEM

P-9

No.	Name		No.	Name	
P9-1	Washer M 5		P9-31	Tension base thread guide (Upper)	TMBE-69-132
-2	Set screw M 6×6		-32	PC Board	TMBE-69-133
-3	Washer M 4		-33	Tension release shaft bearing	TMBE-69-139-2
-4	Screw 9/64×40×6		-34	Connector base	TMBE-69-149
-5	Screw M 4×5		-35	Tension spring presser	TMBE-69-054
-6	Bolt M 5×10		-36	Tension release collar	TMBE-69-171
-7	Set screw M 5×5		-37	Set screw M 4×4	
-8	Screw 9/64×40×10		-38	Tension base cover	TMBE-69-152 275
-9	Screw 9/64×40×6		-38	Tension base cover	TMBE-69-152 295
-10	Washer M 3		-38	Tension base cover	TMBE-69-152 345
-11	Screw M 3×10		-38	Tension base cover	TMBE-69-152 360
-12	No.1 Tension base bracket	TMBE-69-134	-38	Tension base cover	TMBE-69-152 400
-13	No.2 Tension base bracket	TMBE-69-135	-38	Tension base cover	TMBE-69-152 460 (23CW)
-14	Tension base cover	TMBE-69-136	-39	PC Board (for IC)	TMBE-69-170-1 2/3 A5359-PL02A
-15	No.2 Tension base bracket side cover	TME-6912	-40	PC Board (for LED)	TMBE-60-170-2
-16	Tension base bracket cover L	TMBE-69-174	-41	PC Board bracket	TMBE-69-168
-17	Tension base	TMBE-69-120	-42	Nut M 3	
-18	Tension holder	TMBE-69-021	-43	Contact point bracket	TMBE-69-167
-19	Screw 9/64×40×6		-44	10φ collar	TMB-04-034
-20	Screw 9/64×40×8		-45	Tension release shaft: R	TMBE-69-150
-21	Thread tension stud	TMBE-69-122	-46	Tension release shaft: L	TMBE-69-151
-22	Insulation plate	TMBE-69-023	-47	10φ Joint	TMB-05-012
-23	Felt gasket	TMBE-69-024	-48	Cable clip	
-24	Rotary tension	TMBE-69-025	-49	Screw M 3×6	
-25	Tension collar	TMBE-69-026	-50	Connector	
-26	Tension screw	TMBE-69-027	-51	Tension release cover	TMBE-69-163
-27	Tension regulator	TMBE-69-028	-52	Tension release shaft bearing	TMBE-64-131
-28	Tension take-up spring	TMBE-69-029	-53	Bolt M 5×12	
-29	Tension release pin	TMBE-69-130	-54	Tension release pulley cover	
-30	Tension base thread guide (Upper)	TMBE-69-131	-55	Tension release joint pulley	TME-6430

